

# Friends of the Blue Hills

## Trail Volunteer Work Report

**Work date (mm/dd/yy):** 4/24/10

**Report date:** 4/25/10

**Your name:** Robert Flagg

**List Volunteers working with you:**

Tim Leung, Merike Van Zanten, Pat Wood, Stephen Najarian, James Honton, Laurie Staveski, Cindy Burns, Martine Carroll, Kirsten Newcomer, Paul Phalan, George Mileris, Amir Degany, Caleb Blankenship, Len Albright, Mike Quinn, Jan Shifren, Andrew Shifren, John Harrington, Joe Sloane

**Trail Name:** Coon Hollow Path

**Section Name/Description:**

Hillside St to Wildcat Notch Path

**Work Completed (Please be specific with location of work. Note hazards & potential hazards addressed if applicable):**

Completed work detailed on construction project 10-001. Added two new grade reversals, improved two dips with additional buried rock and added a row of buried rocks behind a waterbar. Improved outflows by making them wider and the collection area on the trail larger to direct flow off trail before the grade reversal. Collected fill that had washed off the trail into the woods during heavy rains and brought back on the trail to fill in erosion cuts on trail. Also worked on nine waterbars and dips east of intersection with South Skyline Trail. Widened outflow areas to accommodate more waterflow and rework collection areas on trail.


**Total Hours (# of people x hours worked):** 63.00

**Work Remaining:**

There is a lot of new work west of Marker 1120 and we should keep an eye on this to see it functions properly. The first waterbar east of the South Skyline Trail has a large rock on the trail. The rock should be removed but it might be pretty big. Possibly, we could drill into it and split it (work to be done by someone with rock experience). It will also be interesting to see how the wider outflow areas work.

**Other comments (areas of concern, wildlife sightings, trail markings and signage condition, need for re-route, possible encroachment):**


Forward completed electronic form to: Dexter Robinson @ [dexpcdoc@gmail.com](mailto:dexpcdoc@gmail.com)

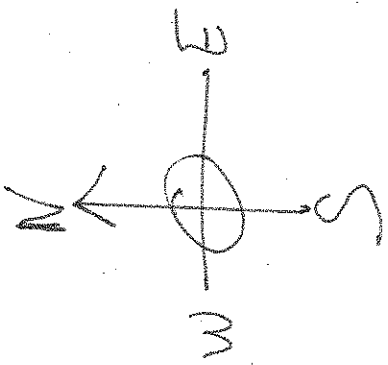

1120 Five Corners Path

1 50' Add GR Heavy erosion - fix o/f (widen)

2 65' Add row of rocks WB Widen o/f

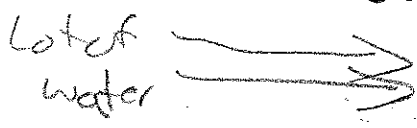

3 60' Add GR - 3 rows Lots of fill - 30 buckets? Harden o/f

35' Erosion cuts Backfill - what to do about geofabric that is exposed?

Add rocks to trail to fix breach

4 Harden Bank Dig widen o/f widen trough Some fill - scatter?



5 GR Dig widen o/f - remove some of bank - Remove pine tree - improve trough on trail

Coon Hollow Path 4/10/10 RAF

Exhibit A