

# TRAIL ASSESSMENT FORM

<b>Doc. #</b>	3003b	<b>Trail Name</b>	Bouncing Brook	<b>Trail Type:</b>		<b>Condition</b>	
<b>Route:</b>	Rt 28 to Wood Rd						
<b>MAINTENANCE</b>		<p>.88 miles [Intersection with Slide Hill Trail] culvert needs cleaning; also clean side ditches up Slide Hill Trail</p> <p>.87 culvert needs cleaning, also side ditch (80 yards) needs cleaning with iron rake to remove leaves and small branches</p> <p>.83 culvert needs cleaning, also side ditch (150 yards)</p> <p>.82 double culvert needs cleaning; also side ditch going up Braintree Pass Path</p> <p>.64 [Intersection with Lee Path] clean side ditch that comes down the hill to the culvert (60 yards). Water flows down from side slope so need to make sure water drops into side ditch and does not overflow onto the trail</p> <p>.61 AMC added a second waterbar and it could use some cleaning and maybe add more rock behind waterbar</p> <p>.59 [Marker 3085] culvert outflow area needs removal of some large logs</p> <p>.58 need to clean side ditch of leaves and small branches; water flows downside slope so need o make sure water is captured in side ditch and does not flow onto trail</p> <p>578 yards large culvert needs light cleaning</p> <p>230 yards need to brush trail to end of trail.</p>					
<b>CONSTRUCTION PROJECTS</b>		<p>.86 miles About 15' past intersection, there is a cut in the left bank and a good location for a new grade reversal, This would catch water that overflows from the double culvert and keep water from flowing down the trail. Currently the water is eroding about 200 yards of trail. Plenty of local rock.</p> <p>.62 [Marker 3073] Water flows down Side Notch Path onto Bouncing Brook. Need to install grade reversal about 15' up Side Notch to direct water to side ditch and into side ditch on Bouncing Brook. The side ditch on Bouncing Brook needs to be improved. There is a large rock in the side ditch that may have to be worked around.</p> <p>.61 AMC replaced rotted railroad ties with large log. Need to add row of rocks behind the waterbar to build up the level a bit to divert water off trail. Currently, water is overflowing waterbar. Also need to clean out inflow and outflow areas</p> <p>555 yards Need to site a grade reversal somewhere between 578 &amp; 529 to push water off the trail</p> <p>539 yards There is an old waterbar that could use some improvement. Should create swale across trail to move water from side ditch and move it off trail.</p>					
<b>MAJOR PROJECTS</b>		<p>.82 miles Intersection with Braintree Pass Path has heavy water flow which has caused a lot of erosion. Need to look at whole intersection and develop correction plan.</p>					
<b>OTHER</b>		<p>Assessment noted Marker 3023 [Intersection with Slide Hill Trail] missing but it doesn't appear on any maps.</p>					
			Bob Flagg		<b>Assessment date:</b>	10/15/10	