

# TRAIL ASSESSMENT FORM

<b>Doc. #</b>	4016	<b>Trail Name</b>	Cedar Rock Path South	<b>Trail Type:</b>	<b>Wide - M</b>	<b>Condition</b>	Good
<b>Route:</b>		4012 to Chickatawbut Road					
<b>Recent Weather:</b>		No rain last 48 hours, Sunny in the 30's					
<b>TRAIL LANDMARKS</b>		<ul style="list-style-type: none"> <li>Trailhead leaves on the east side of Headquarters Path at intersection marker 4012. Signage denotes direction to Chickatawbut Overlook (SE).</li> <li>Bn and downed limbs at 50 feet as treadway ascends at road width.</li> <li>Overhead bn at 110 feet. Bd extending into treadway and needs to be cutback. 5" Bow saw.</li> <li>Bn at 265 feet. Bd extending into treadway and needs to be cutback. 5" Bow saw.</li> <li>Rkw wb in the treadway at 345 feet. R to L into dt. Needs to be dug out, additional rkw added to treadway width and dt cleaned. Unnamed path leaves on left. (1)</li> <li>Bn at 395 feet as treadway ascends at road width.</li> <li>Treadway levels out at .11 miles with bn, sbd and downed limbs. Bow saw and loppers.</li> <li>Bn at .13 miles with unnamed path leaving on left with signage. "No Trespassing – This is Not a Hiking Trail – Return to Established Hiking Trail".</li> <li>Unnamed path crosses at .16 miles. Footpath width.</li> <li>Unnamed leaves on right at .19 miles. Footpath width with signage.</li> <li>Unnamed leaves on right at .2 miles. Footpath width with signage.</li> <li>Downed limb crosses treadway at .21 miles. Cutback or remove. Acting as a wb.</li> <li>Unnamed path leaves on left at .22 miles.</li> <li>Wooden wb at .22 miles. Ineffective as it is rotted. Remove and replace and dig out dt. (2)</li> <li>Significant bn at .24 miles. Downed limbs on L and R. Bow saw and loppers.</li> <li>Cedar Rock Path ends with its intersection with Chickatawbut Road at .26 miles at a fire gate. Signage on tree noting CCC Camp round trip 2.5 miles. Cv under Chickatawbut Road to the right of the treadway. Rkw/cement construction with 24" clay pipe.</li> </ul>					
<b>MINOR PROBLEM AREAS</b>		<ol style="list-style-type: none"> <li>Rkw wb in the treadway at 345 feet. R to L into dt. Needs to be dug out, additional rkw added to treadway width and dt cleaned (1)</li> <li>Wooden wb at .22 miles. Ineffective as it is rotted. Remove and replace and dig out dt. (2)</li> </ol>					
<b>MAJOR PROBLEM AREAS</b>		<ul style="list-style-type: none"> <li>None Noted</li> </ul>					
<b>DISTANCES TO MAJOR</b>		<ul style="list-style-type: none"> <li>Headquarters Path at intersection marker 4012 to Cedar Rock Path ends at Chickatawbut Road - .26 miles</li> </ul>					

<b>INTERSECTIONS</b>			
<b>Report prepared by:</b>	Ken Jones – 3/24/08	<b>Assessment date:</b>	3/24/2008

### Abbreviations:

Usage type: foot traffic only (H), multi-use (M)

waterbars (wb)	small blowdowns (sbd)
culverts(cv)	large blowdowns (lbd)
rolling dips (rd)	rock work (rkw)
bridges (br)	bridge building (bbd),
bog bridges (bb)	culvert replacement (cr)
rock stairs (rs)	trail relocation (tr),
cribbing (cb)	building new trail drainage (ntd)
retaining walls (rw)	brushing needed (bn)
ditches (dt)	excessive erosion (ee)
	leaning tree (lt)